



## RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME MILE HIGH PINES CAMP				REINSPECTION DATE Not Specified		INSPECTOR Tho Do		DATE 6/16/2016					
LOCATION 42739 HWY 38 , ANGELUS OAKS, CA 92305				PERMIT EXPIRATION 6/30/2016		IDENTIFIER: Pool  SERVICE: 001 - INSPECTION - ROUTINE  RESULT: 03 - CORRECTIVE ACTION / NO FOLLOW UP RE  ACTION: 01 - NO FURTHER ACTION REQUIRED							
TIME IN 11:30 AM		TIME OUT 12:00 PM		FACILITY ID FA0006916						RELATED ID PR0000455		PE 3620	

### RECREATIONAL HEALTH - Public Pool - Initial Pool at Facility

Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional inspection to be billed at the hourly rate as provided in the San Bernardino County Code, [Schedule of Fees](#).




Administrative Order to Show Cause (OSC): The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked; otherwise the right to a hearing shall be deemed waived.

96

SCORE

See the following pages for the code sections and general requirements that correspond to each violation listed below.

Ideal
In Compliance
Not in Compliance

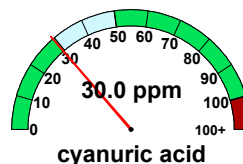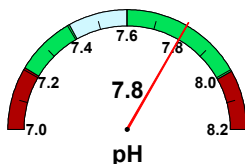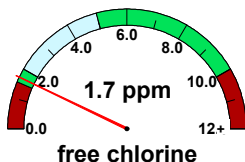

temperature (°F)	No Data
observed flow (gpm)	No Data
required flow (gpm)	No Data
volume (gal)	No Data
area (sq ft)	No Data
occupancy	No Data

#### IMPORTANT: Replacement of Suction Outlet Covers

Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:

1. Meet the latest ANSI/APSP-16 performance standard
2. Be rated for the maximum designed flow-rate of the pump

Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

#### 36K504 Water Quality – Non-Critical – Disinfectant level low

POINTS 1	Compliance Date: Not Specified	<b>Inspector Comments:</b> Free pool chlorine level was measured at 1.68 ppm. Maintain free pool chlorine level at 1.0 ppm without cyanuric acid or 2.0 ppm with cyanuric acid. The maximum free chlorine level shall be 10.0 ppm. Operator was notified regarding the low chlorine level.
	Not In Compliance	
	Violation Reference - HSC - 65529	

**Violation Description:** The minimum concentration of disinfectant residual in public pools shall be 1.0 ppm free-chlorine without cyanuric acid or 2.0 ppm free-chlorine with cyanuric acid. The minimum concentration of disinfectant residual in public spas, wading pools, and spray grounds shall be 3.0 ppm free-chlorine. The maximum concentration of disinfectant residual shall be 10.0 ppm free-chlorine.

The minimum concentration of bromine residual in public pools shall be 2.0 ppm. The minimum concentration of bromine residual in public spas, wading pools, and spray grounds shall be 4.0 ppm.

#### 36K565 Decking - Requirements

POINTS 1	Compliance Date: Not Specified	<b>Inspector Comments:</b> Observed raise cement within the continuous and unobstructed 4-foot wide deck area. Maintain the 4-foot wide deck area in good repair and working condition all times. Repair or replace as necessary. Operator was notified regarding raised cement.
	Not In Compliance	
	Violation Reference - CCR 24 - 3114B	

**Violation Description:** A minimum continuous and unobstructed 4-foot wide (1219 mm) slip resistant, cleanable, nonabrasive deck area of concrete or like material shall be provided flush with the top of the pool coping extending completely around the pool, and the deck area shall further extend 4 feet (1219 mm) on both sides and rear of any diving board, fixed disabled access assistance device or slide and their appurtenances. The deck width shall be measured from the poolside edge of the coping lip.

#### 36K566 Lighting – Requirements

POINTS 1	Compliance Date: Not Specified	<b>Inspector Comments:</b> Observed underwater light filled halfway with water. GFCI interrupted electrical current when underwater light was turned on manually. Maintain all underwater light in good repair and working condition at all times. Repair or replace as necessary. Operator was notified regarding water filled underwater light.
	Not In Compliance	
	Violation Reference - CCR - 3115B	

**Violation Description:** Pools shall have underwater and deck lighting such that lifeguards or other persons may observe, without interference from direct and reflected glare from the lighting sources, every part of the underwater area and pool surface, all diving boards or other pool appurtenances.



## RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME MILE HIGH PINES CAMP	DATE 6/16/2016
LOCATION 42739 HWY 38 , ANGELUS OAKS, CA 92305	INSPECTOR Tho Do

### 36K582 Maintenance - Public pool site maintenance

<b>POINTS</b> <b>1</b>	Compliance Date: Not Specified	<b>Inspector Comments:</b> Observed cracked pool coping. Maintain pool coping in good repair condition at all times. Repair or replace as necessary. Operator was notified regarding the cracked coping.
	Not In Compliance	
	Violation Reference - HSC - 65535	

**Violation Description:** The pool operator shall keep all parts of the public pool site well-maintained, including, but not limited to, the public pools, water treatment systems, ancillary facilities, signs, showers, toilets, dressing facilities, drinking fountains, diaper-changing stations, floors, walls, partitions, doors, and lockers.

### Overall Inspection Comments

No summary comments have been made for this inspection.

### Signature(s) of Acknowledgement

C N A

NAME:  
TITLE:

Total # of Images: 0